




## Flex Viewer

Powered by ArcGIS Server

Printed: Oct 23, 2017

The City of San Antonio does not guarantee the accuracy, adequacy, completeness or usefulness of any information. The City does not warrant the completeness, timeliness, or positional, thematic, and attribute accuracy of the GIS data. The GIS data, cartographic products, and associated applications are not legal representations of the depicted data. Information shown on these maps is derived from public records that are constantly undergoing revision. Under no circumstances should GIS-derived products be used for final design purposes. The City provides this information on an "as is" basis without warranty of any kind, express or implied, including but not limited to warranties of merchantability or fitness for a particular purpose, and assumes no responsibility for anyone's use of the information.

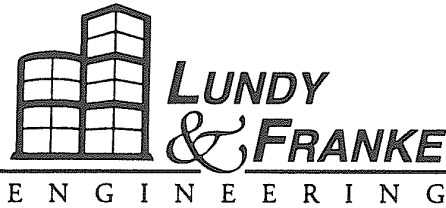

May 18, 2018

Stillwater Capital  
3500 Oakmont Blvd, #205  
Austin, Tx 78731

Attn: Mr. Brandon Easterling

Re: JLSA King House Relocation  
San Antonio, TX

Pursuant to our visit to the above referenced facility, we submit the following report of our findings. The purpose of this observation was to evaluate the feasibility for moving the existing structure across the street and place the structure on a new foundation.

### **OBSERVATIONS**

Observations were made by walking the existing structure, paying particular attention to elements, which indicate the presence of foundation/framing malfunctions or elements which would prohibit the movement of the structure. Existing drawings were not available for our use and the conclusions reached are based on visual observations.

The existing structure is a masonry residence with wood framing. The interior foundation is a typical historic pier and beam foundation. The owner has engaged Dodson House Moving and there is a plan in place for the movement.

### **CONCLUSIONS**

The existing structure is capable of being moved to the new location, the foundation will be designed by this office upon the receipt of the geotechnical report, the final location and coordination with the proposed house moving company. The foundation is assumed to be a combination of a monolithic beam and slab on a prepared subgrade.

## **LIMITATIONS**

Please note that the movement of a masonry house will result in cracks and damage to the brittle material. Once in place these cracks may be repaired and should not affect the overall structural integrity of the building.

The opinions expressed in this report are limited to the matters expressly stated herein and no opinions are implied, or should be inferred, beyond the matters stated. In the formulation of our opinions, we have made and relied upon the assumptions that all statements and representations made to us are true and correct.


Our professional services have been performed with a level of skill and expertise which is usual and customary for professionals engaged in this type of work and is consistent with generally accepted engineering practice.

This investigation does not include a detailed analytical study of the structural elements nor does this report address the structural status of framing members, which are not exposed to view and not readily accessible for visual observation, or other areas not mentioned in this report.


We appreciate this opportunity to be of service. Please call if you have any questions, or if we can be of future assistance.

Sincerely,

LUNDY & FRANKE  
ENGINEERING, INC.

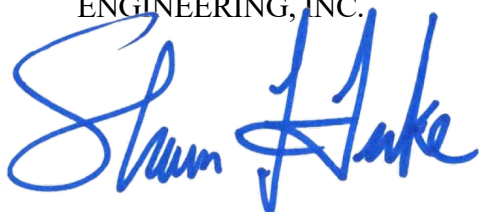

Shawn J. Franke, P.E. SECB  
SJF/sjf

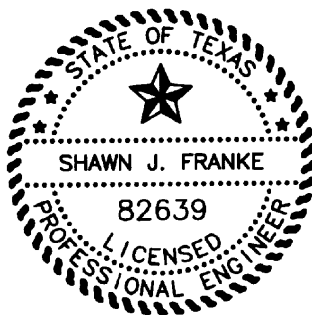



































PLANT LEGEND




EXISTING TREES TO BE REMOVED

EXISTING TREES TO REMAIN

Tag #	Species	Size (inches)	Understory Species* 5.0" - 11.5"		Significant Tree 6" - 23.5"		Significant Tree** 10.0" - 23.5"		Heritage 3:1		Heritage 1:1		Notes
			Removed	Preserved	Removed	Preserved	Removed	Preserved	Removed	Preserved	Removed	Preserved	
32	China Berry	4.8	4.8	0									
36	Live Oak	4.5		4.5									
37	Live Oak	4.5		4.5									
	Sub. Tot. Inches=	4.8	9	0	0	0	0	0	0	0	0	0	0
	Total inches by category=		65%	13.8									
	Preservation percentage=												
	Mitigation required (Commercial) =		-10										
	Mitigation required (Residential) =		-11										
* Small species: Cordalia, Redbud, Tx. Mountain Laurel, Tx. Persimmon, Hawthorn, Possumhaw - mitigated at 1:1 for Heritage					Exemption Codes		Additional Inches Preserved for Mitigation		Heritage Preservation		Heritage Mitigation (inches)		
					1 - Tree is dead				0%		0		
					2 - Tree is in poor health								
					3 - Tree is located within easement								
*** Mitigation Trees: Unprotected-sized trees to be used for mitigation calculations; subtract inches from mitigation owed									Additional Inches Needed to meet Mitigation Requirements		-10		

AUGUSTA STREET

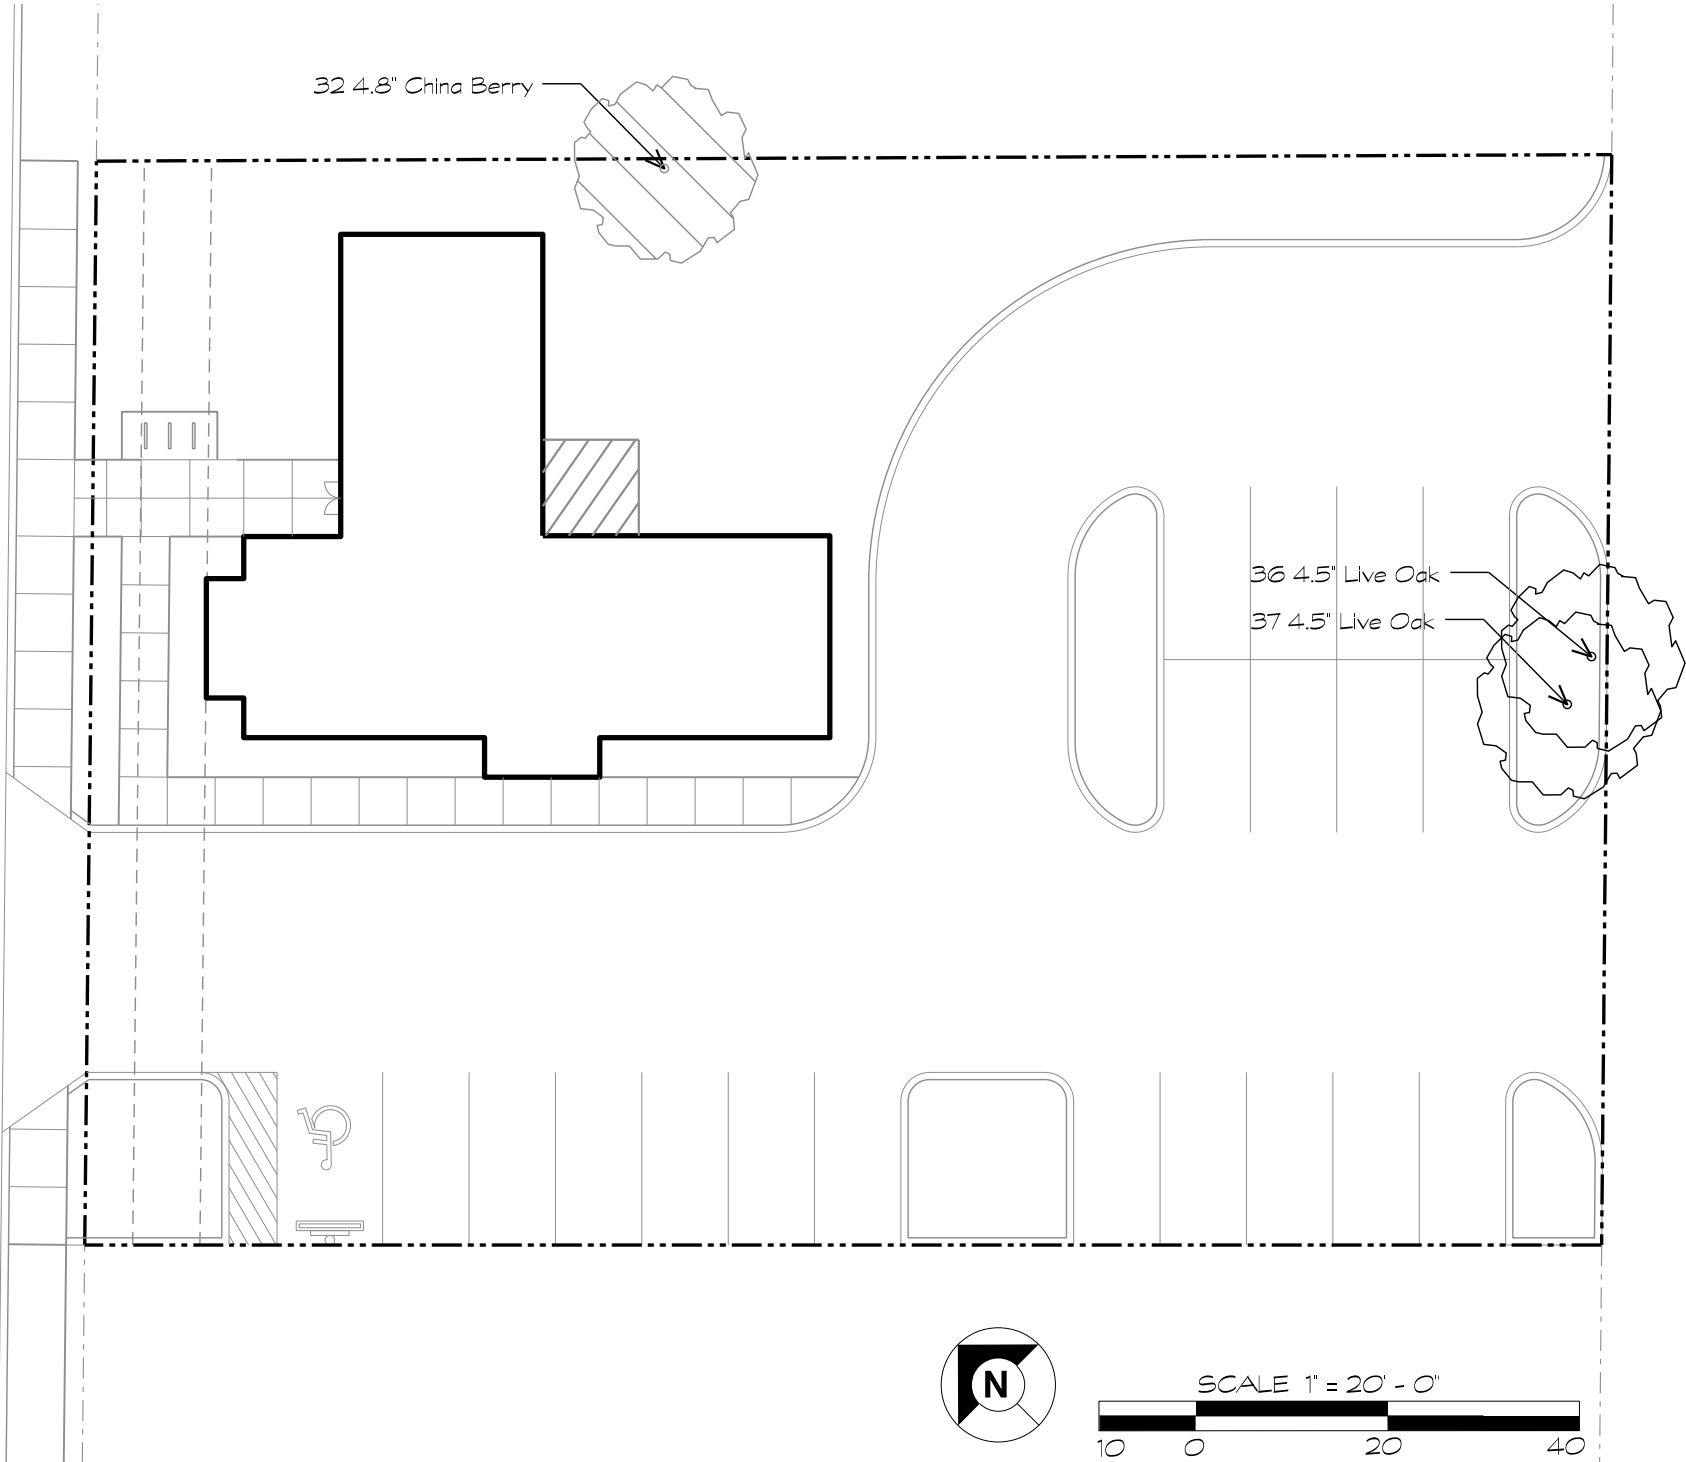

KING BUILDING

STILLWATER CAPITAL

DATE/ISSUE

ISSUE FOR REVIEW 05-14-18



LANDSCAPE ARCHITECTURE  
SITE PLANNING  
URBAN DESIGN

7155 OLD KATY ROAD  
SUITE 270  
HOUSTON, TEXAS 77024  
713-869-6987  
713-869-0908 FAX  
WWW.KWTEXAS.COM

PROJECT NUMBER

SWC 852

SCALE: 1" = 20' - 0"

SHEET TITLE

TREE MITIGATION

SHEET NUMBER


L0.00



PLANT LIST							
SYM	BOTANICAL NAME/ COMMON NAME	CAL	HEIGHT	SPREAD	MIN. ROOT	REMARKS	SOD
TREES							CYNODON SPECIES BERMUDA GRASS
MS	PLATANUS MEXICANA MEXICAN SYCAMORE	3 1/2"	10' - 12'	7 - 8'	65 GAL.	MATCHED, WELL ROOTED	SOLID SOD
LO	QUERCUS VIRGINIANA LIVE OAK	3 1/2"	10' - 12'	7 - 8'	65 GAL.	MATCHED, WELL ROOTED	
GROUND COVER							GRASSES
BF	DIETES VEGETA BUTTERFLY IRIS		16"	10"	3 GAL.	FULL, WELL ROOTED 18" O.C.	GMG MUHLENBERGIA CAPILLARIS GULF MUHLY GRASS
NG	LANTANA X HYBRIDA 'NEW GOLD' NEW GOLD LANTANA		12"	12"	1 GAL.	FULL, WELL ROOTED 18" O.C.	
TB	BULBINE FRUTESCENS 'TANGERINE' TANGERINE AFRICAN BULBINE		14"	6"	1 GAL.	FULL, WELL ROOTED 18" O.C.	
AJ	TRACHELOSPERMUM ASIATICUM ASIAN JASMINE		8"	4"	1 GAL.	FULL, WELL ROOTED 12" O.C.	

PLANT LEGEND	
	NURSERY GROWN TREES
	EXISTING TREES
	SHRUBS/GROUNDCOVERS
	SOLID SOD COMMON BERMUDA GRASS
ST	TREES TO FULFILL STREET TREE REQUIREMENT
PLT	TREES TO FULFILL PARKING LOT TREE REQUIREMENT

CITY OF SAN ANTONIO ORDINANCE	
1) TREE PRESERVATION ORDINANCE COMPLIANCE	
See Tree Preservation Plan TP1.01 and Mitigation Table this sheet	
2) TREE CANOPY REQUIREMENT	
Total Site Area: 17,876 s.f. x 25% = 4,469 s.f. Canopy Required	
PROPOSED TREES:	
3 Mexican Sycamore (90% @ 1080 s.f.) = 3,240 s.f.	
4 Live Oaks (90% @ 787.5 s.f.) = 3,150 s.f.	
EXISTING TREES TO REMAIN:	
2 Oaks (100% @ 875 s.f.) = 1,750 s.f.	
TOTAL PROPOSED: 8,140 s.f. (45.5%)	
3) LANDSCAPE ORDINANCE COMPLIANCE - 70 PTS REQUIRED	
A. STREET TREES: 25 POINTS	
Augusta Street:	
113 l.f. Street Frontage x 75% = 85 l.f.	
85 l.f. / 50' o.c. = 2 Street Trees Required & Provided	
B. PARKING SHADE TREE CALCULATION: 20 POINTS	
Square footage of proposed parking area 5,515 s.f. x .25 = 1,379 s.f. REQUIRED	
2 Preserved Live Oak Trees (100% of 875 = 875 s.f.) = 1,750 s.f.	
2 Live Oak Trees (90% of 875 = 787.5 s.f.) = 1,575 s.f.	
3 Mexican Sycamore Trees (90% of 1200 = 1080 s.f.) = 3,240 s.f.	
TOTAL PROPOSED: 6,565 s.f. (119%)	
C. PARKING LOT SCREENING: 25 POINTS	
Shrubs to be at least 30 inches in height, forming an opaque visual barrier at maturity.	
Complies with restrictions in UDC Sect. 35-506 for clear vision area. Screening extends along the entire street frontage of the surface parking lot, exclusive of driveways.	
TOTAL POINTS: 70 POINTS	
4) BUFFER YARD REQUIREMENTS	
Adjoining Zoning District is C2. No Buffer Yard Required.	
HWY 281 - Type 'B' 25 foot buffer	

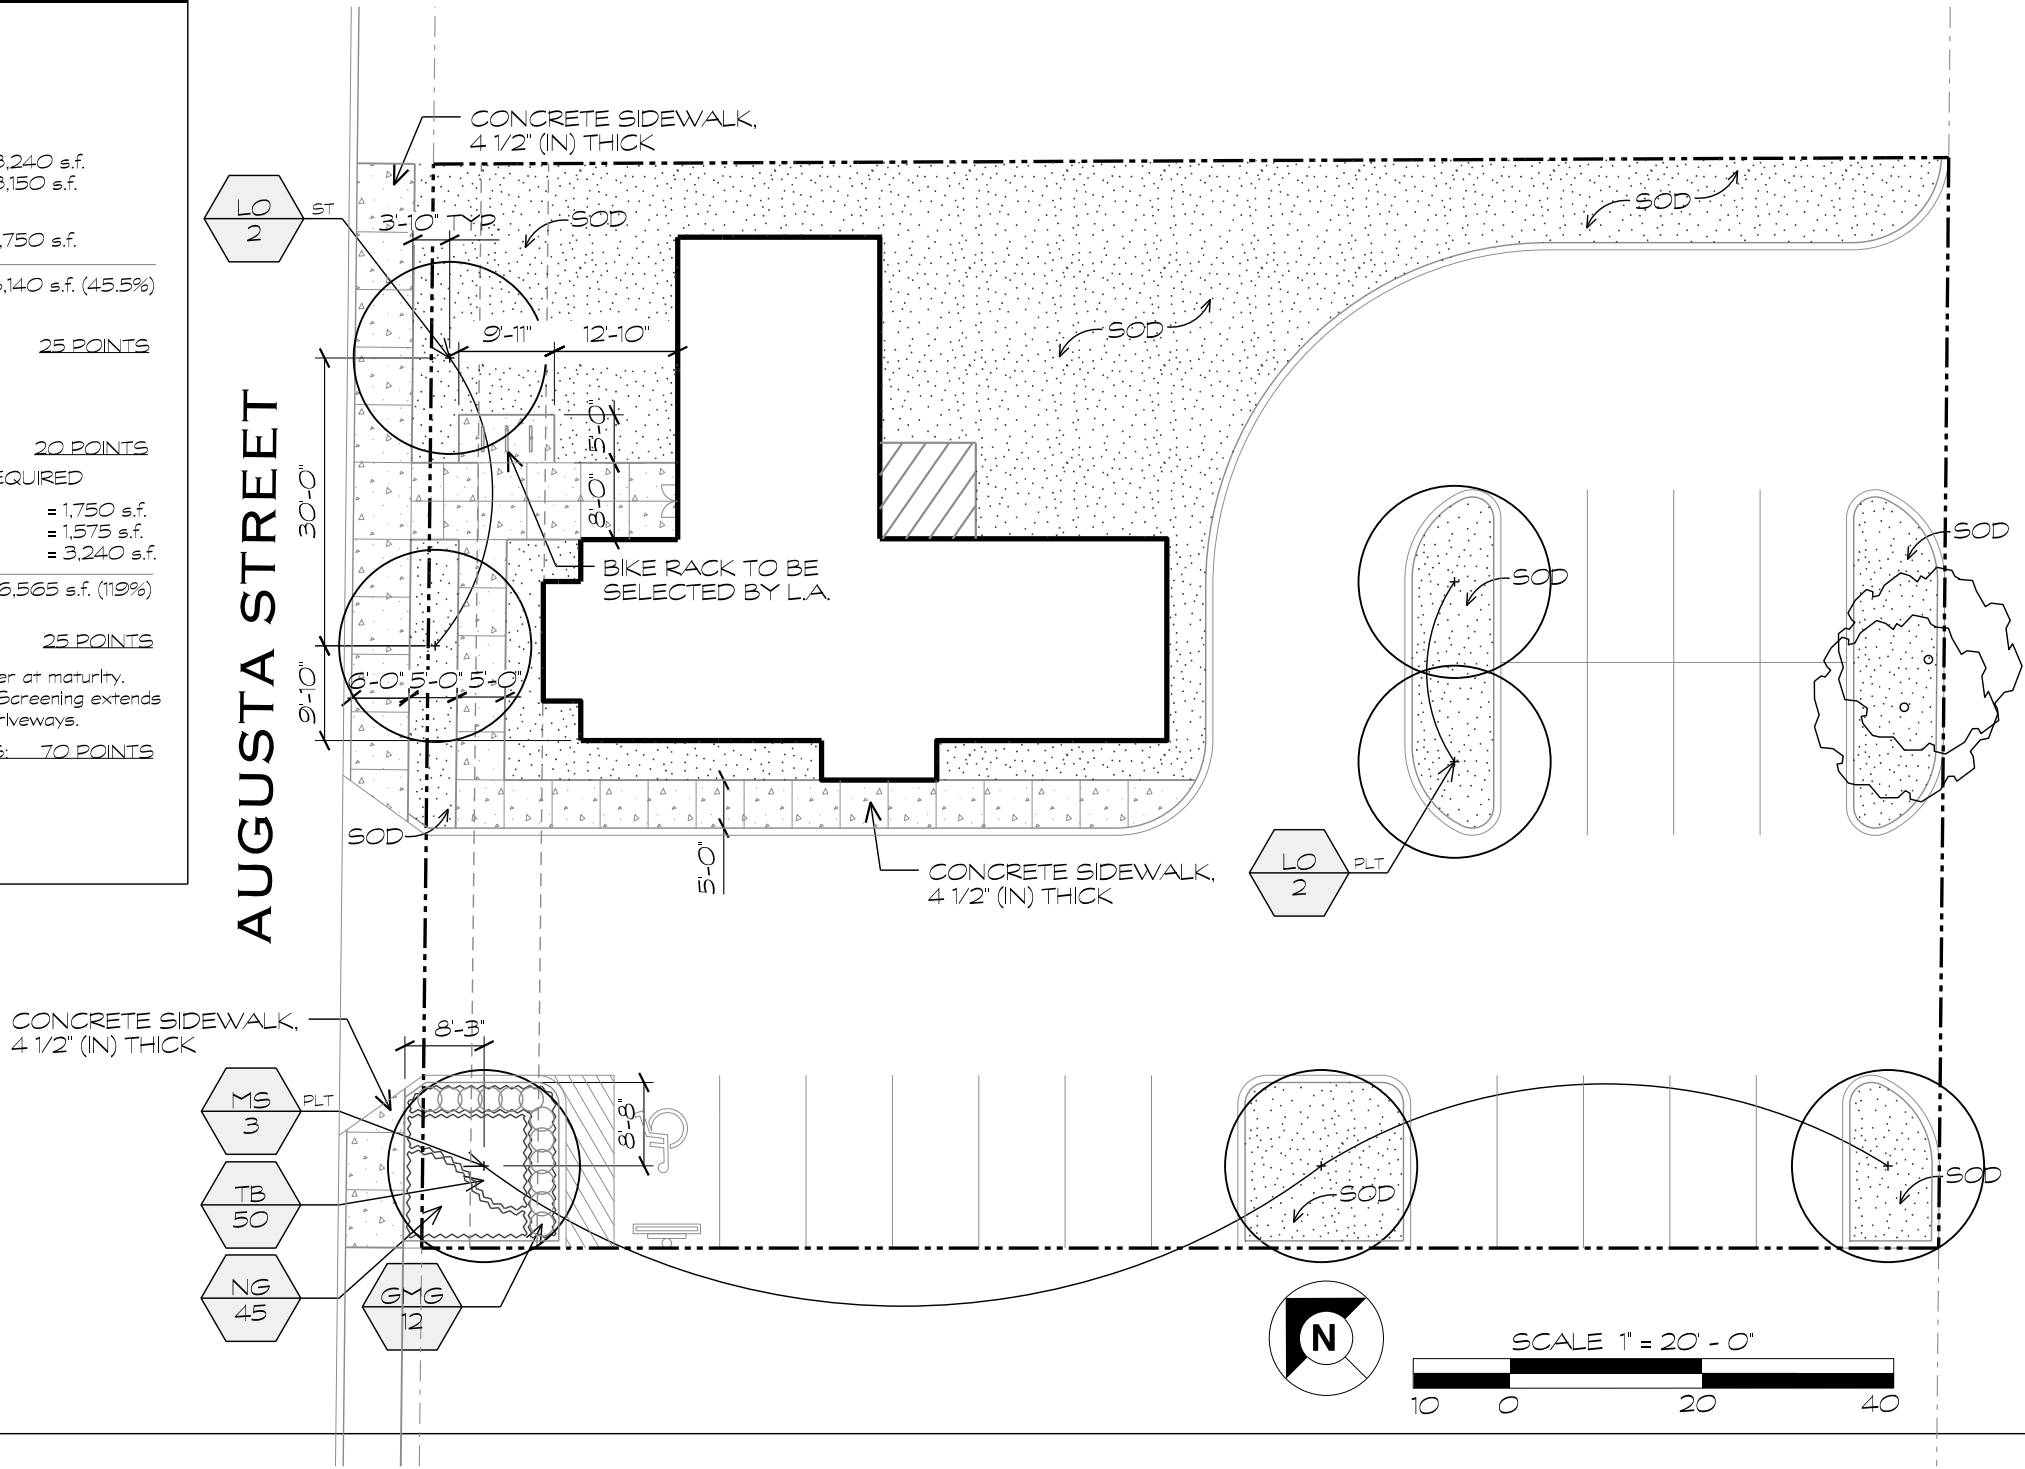

STILLWATER CAPITAL	
DATE/ISSUE	
ISSUE FOR REVIEW 05-14-18	

LANDSCAPE ARCHITECTURE  
SITE PLANNING  
URBAN DESIGN

7155 OLD KATY ROAD  
SUITE 270  
HOUSTON, TEXAS 77024  
713-869-6987  
713-869-0908 FAX  
WWW.KWTEXAS.COM

PROJECT NUMBER	
SWC 852	
SCALE: 1" = 20' - 0"	
SHEET TITLE	
PLANTING & SITE EXHIBIT	
SHEET NUMBER	
L0.01	





# **DR. KING HOUSE**

**ARCHITECT ALFRED GILES 1880**



# **DODSON HOUSE MOVING**

**PRESENTED BY  
GATOR DODSON  
&  
EDGAR DODSON**

---




## DIMENSIONS



66' x 57' Boxed Dimensions  
Approximately 2,200 SQFT  
21' x 15' Basement  
18" Rock Walls  
12' Interior Height  
2 Fireplaces  
3 Rocked Gable Ends



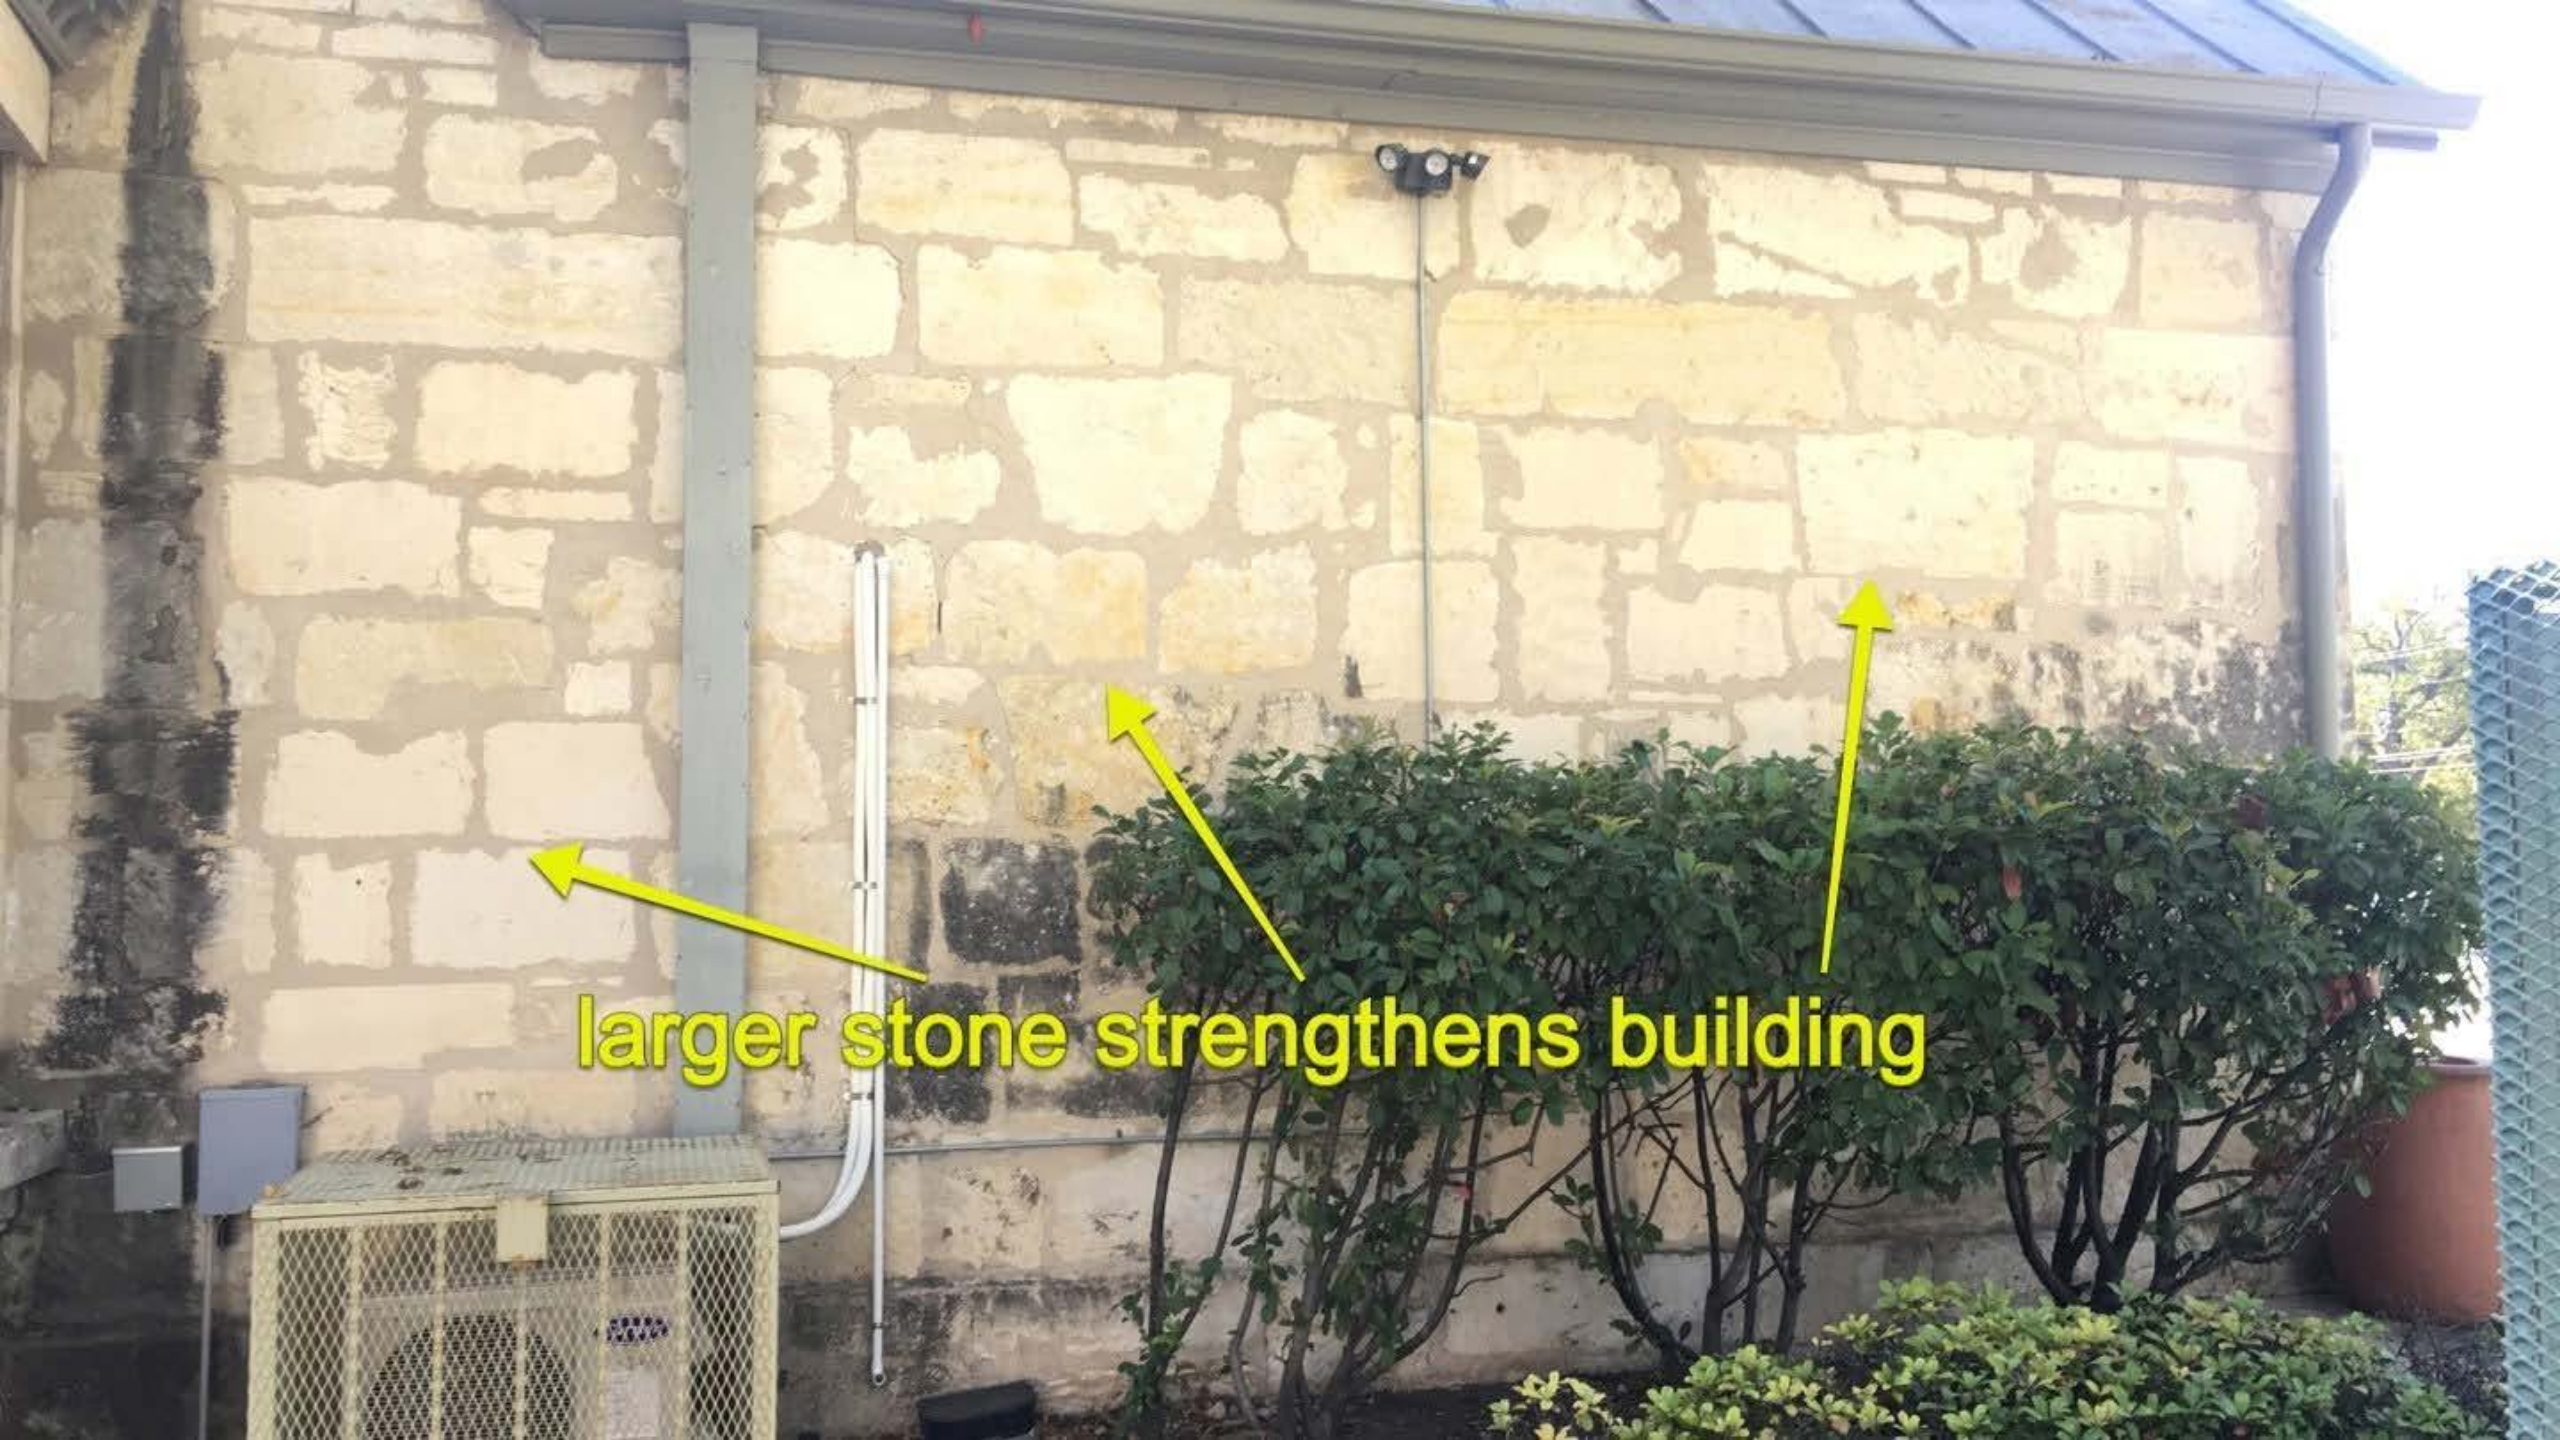

larger stone strengthens building





Rock Gable end

Fireplace









From God, Steve &





**Demolish Concrete porch patio, roof to remain**



A photograph of a dark-colored double door with decorative glass panels featuring a fish-scale pattern. The door is set within a light-colored wall. A red rectangular outline is drawn around the door frame, indicating the area to be removed. The text 'Remove Decorative door and block opening' is overlaid in yellow at the bottom.

**Remove Decorative door and block opening**









## 400 Ton rock walls

## Estimated 560 Ton






Yellow Line bottom of Floor joist




Cross Loaders

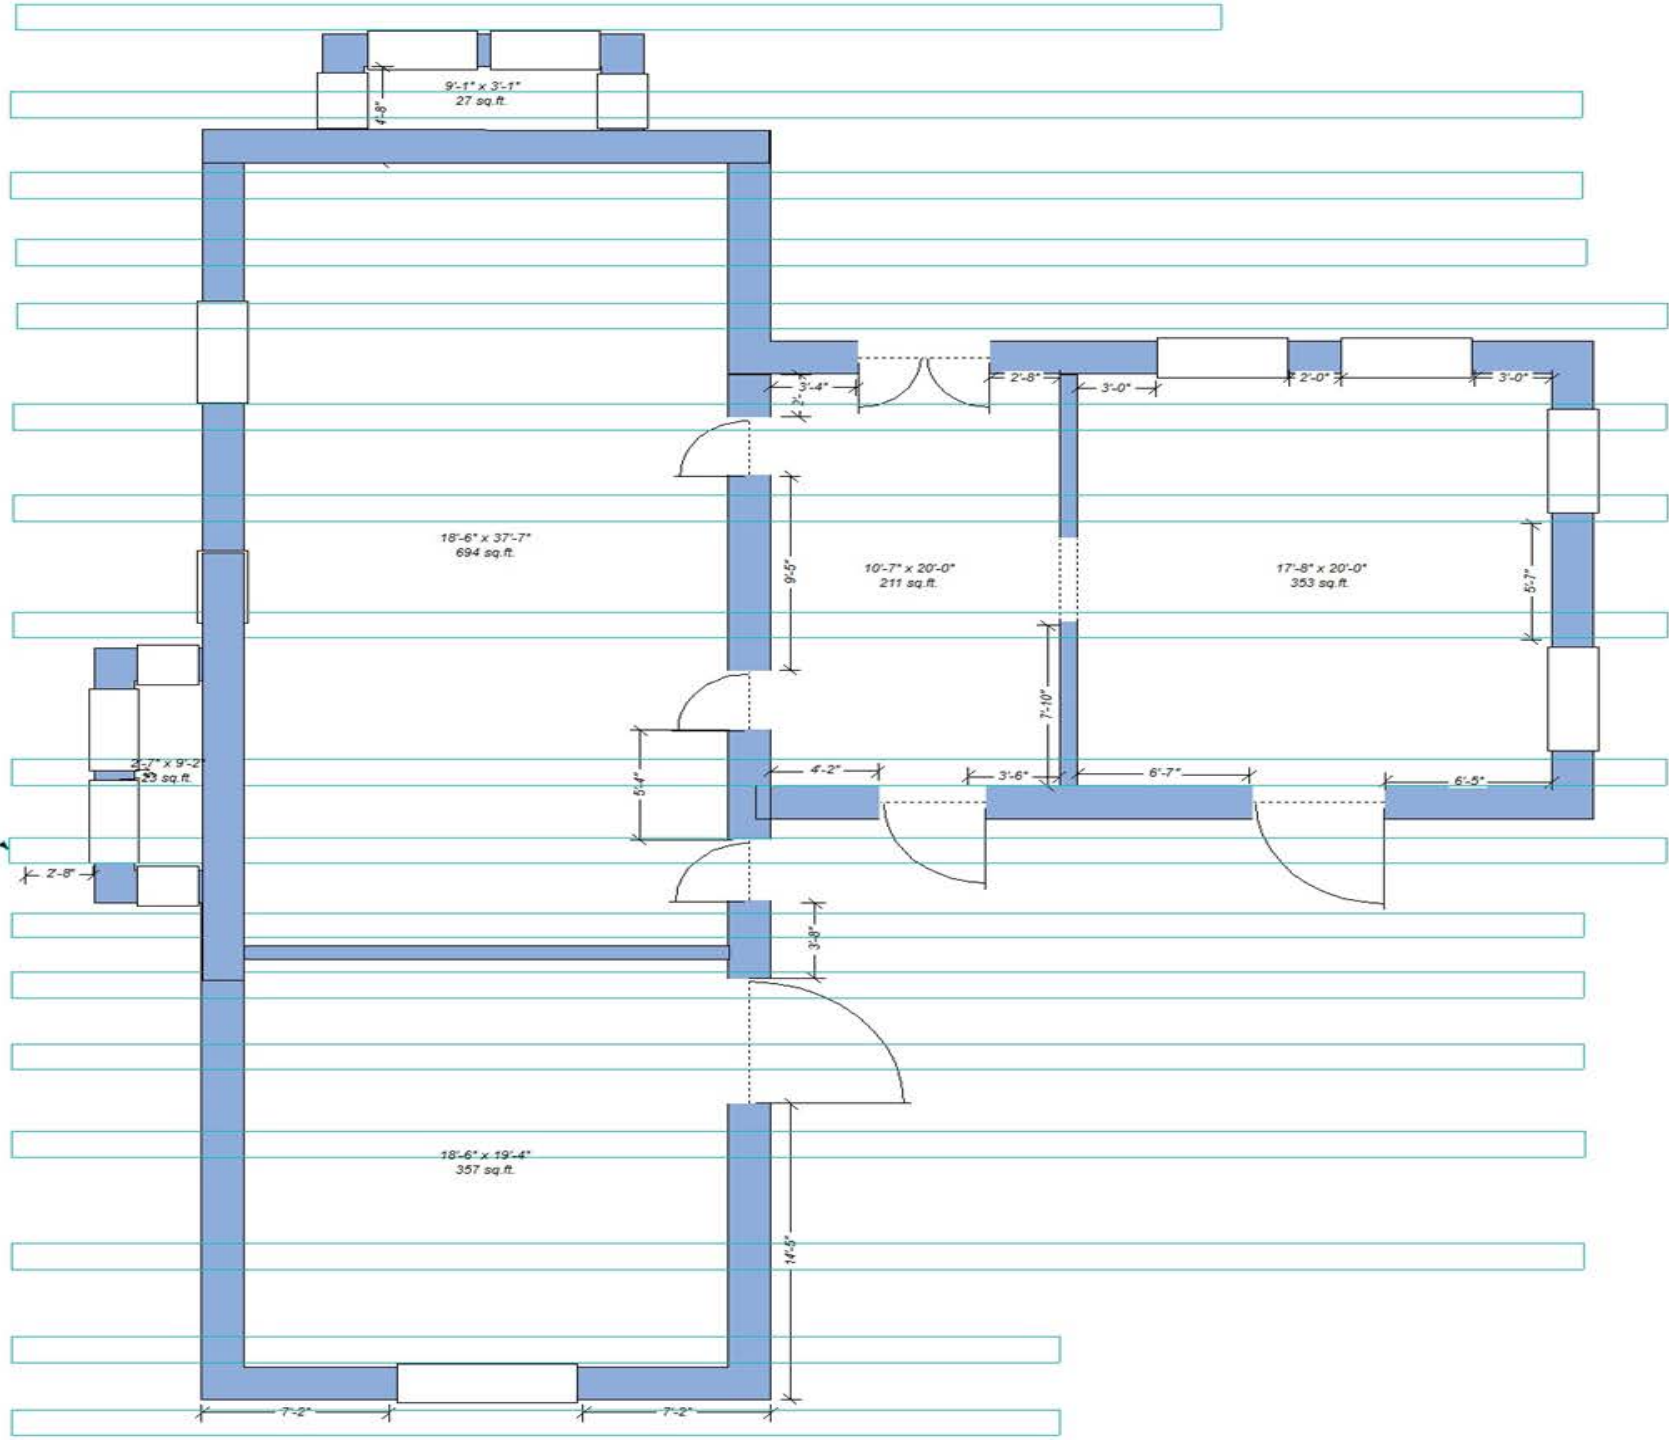








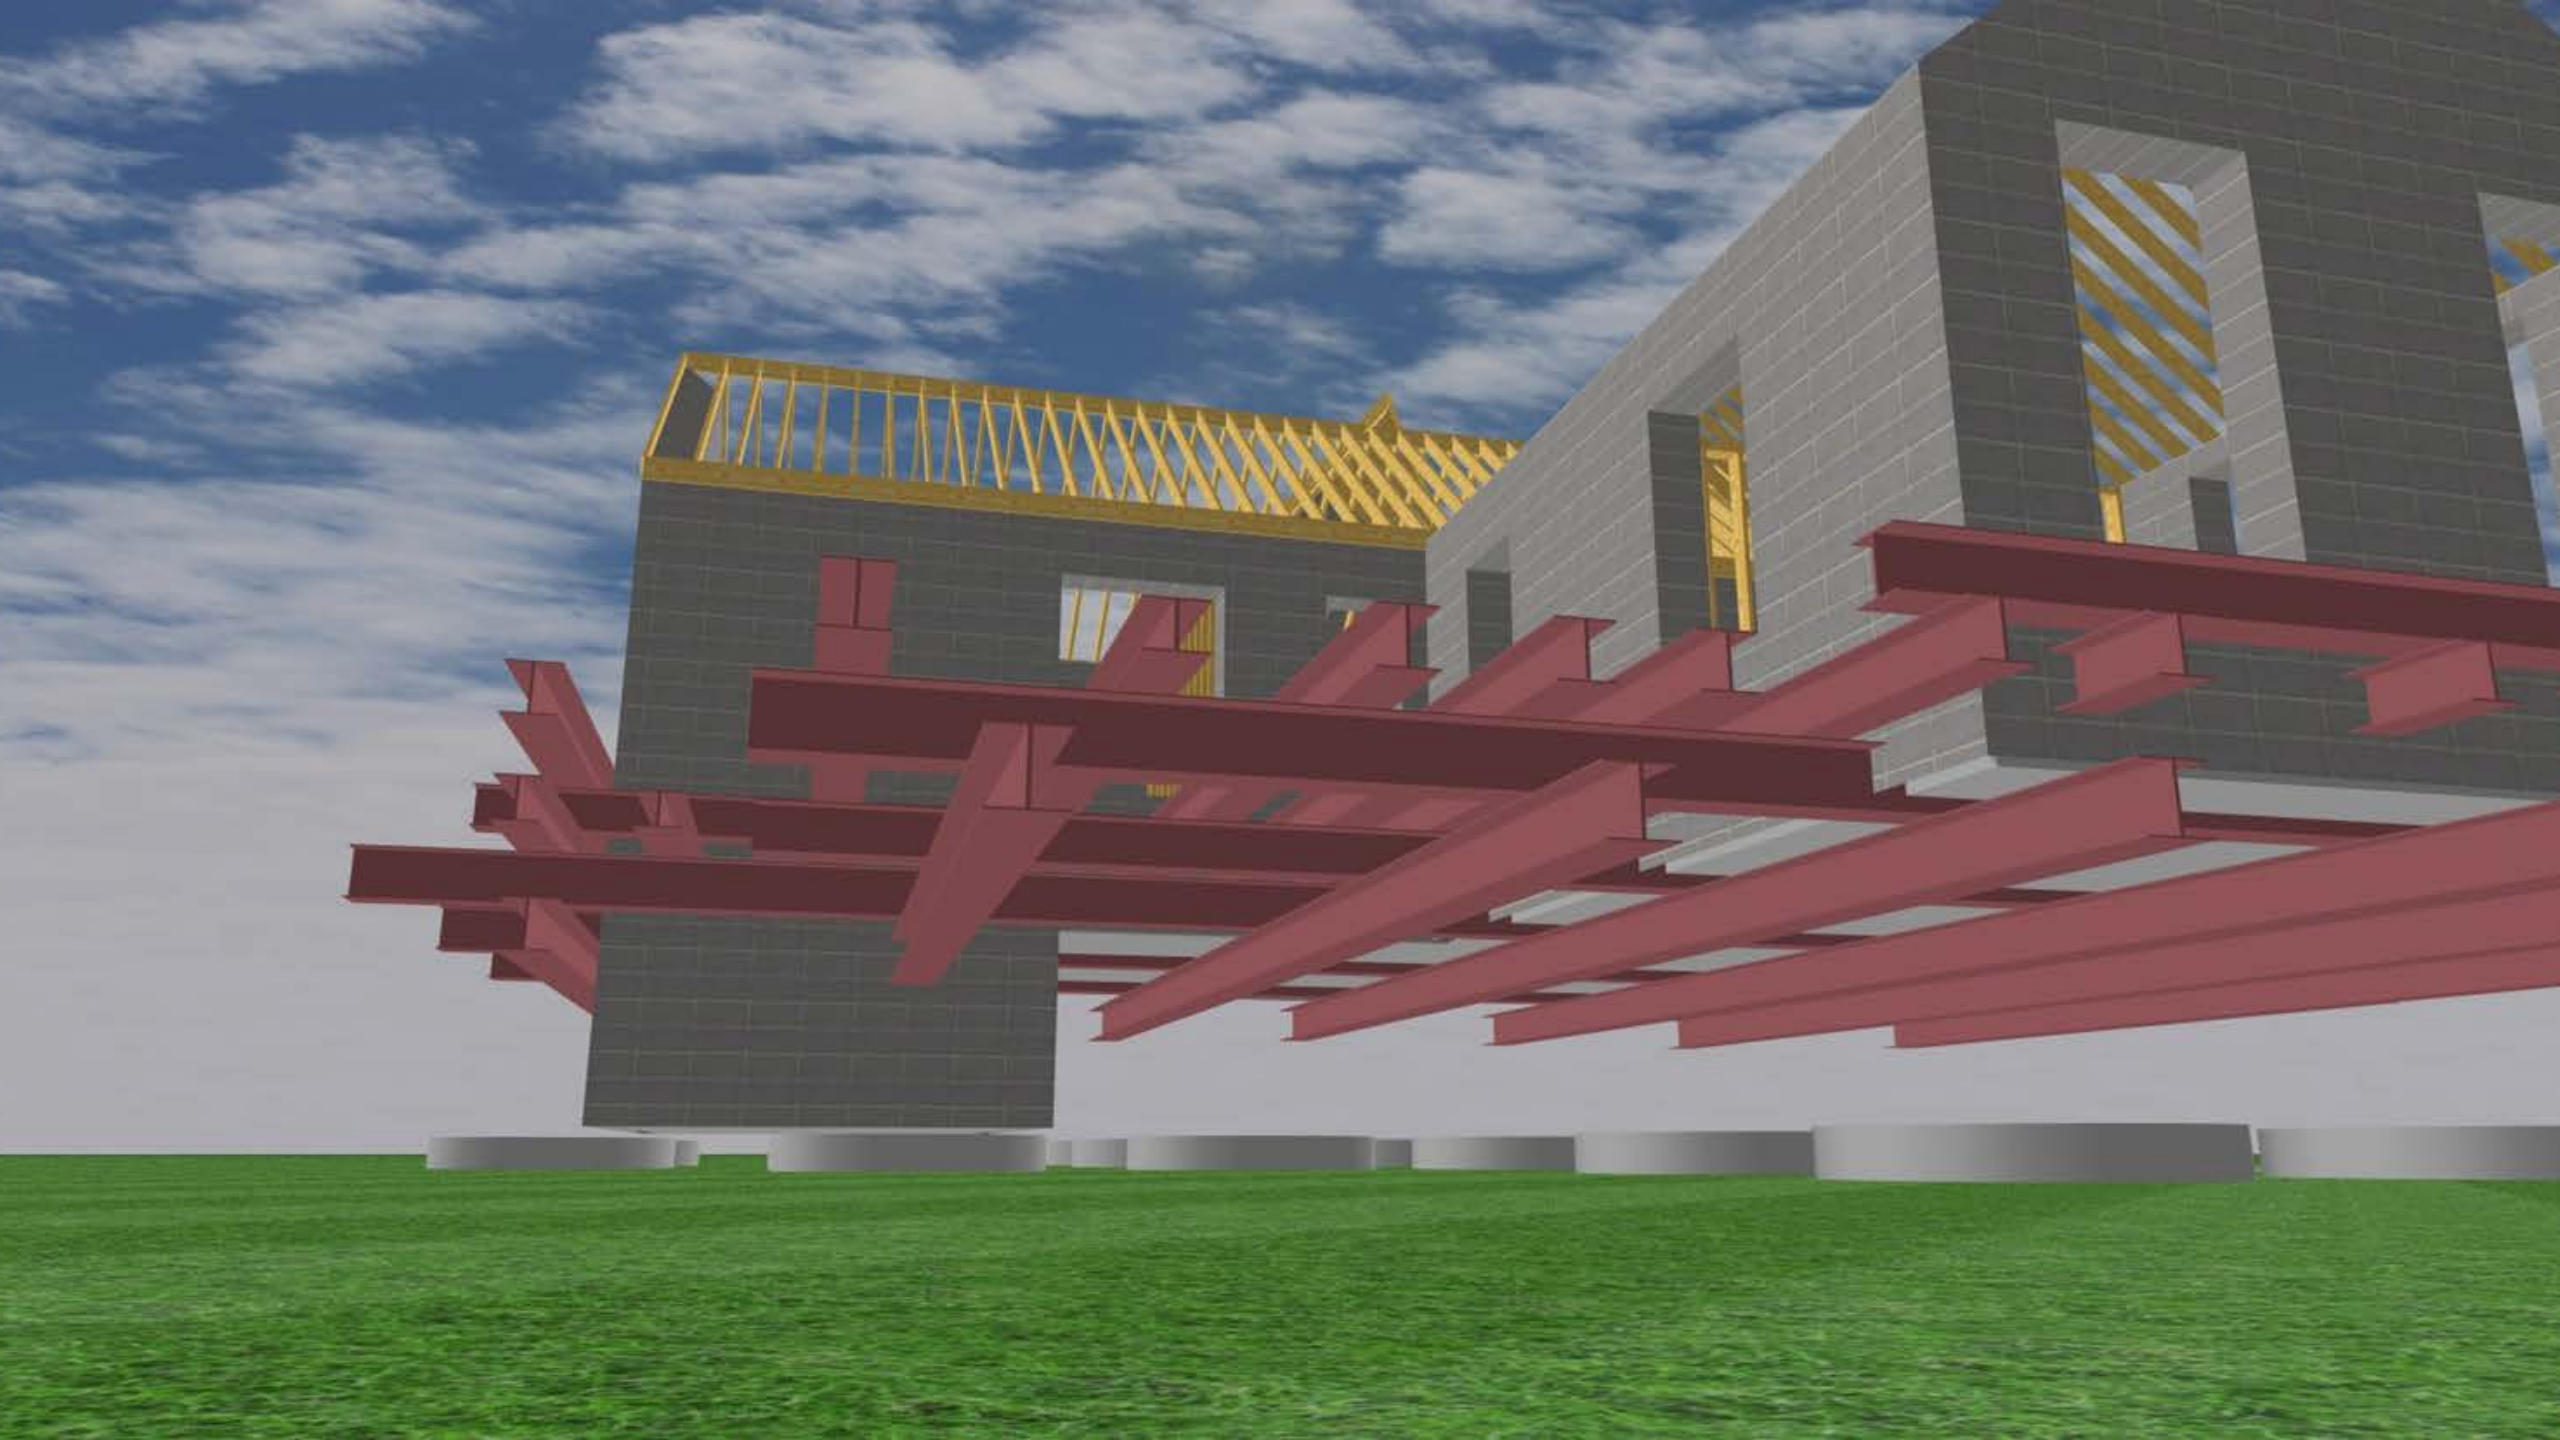



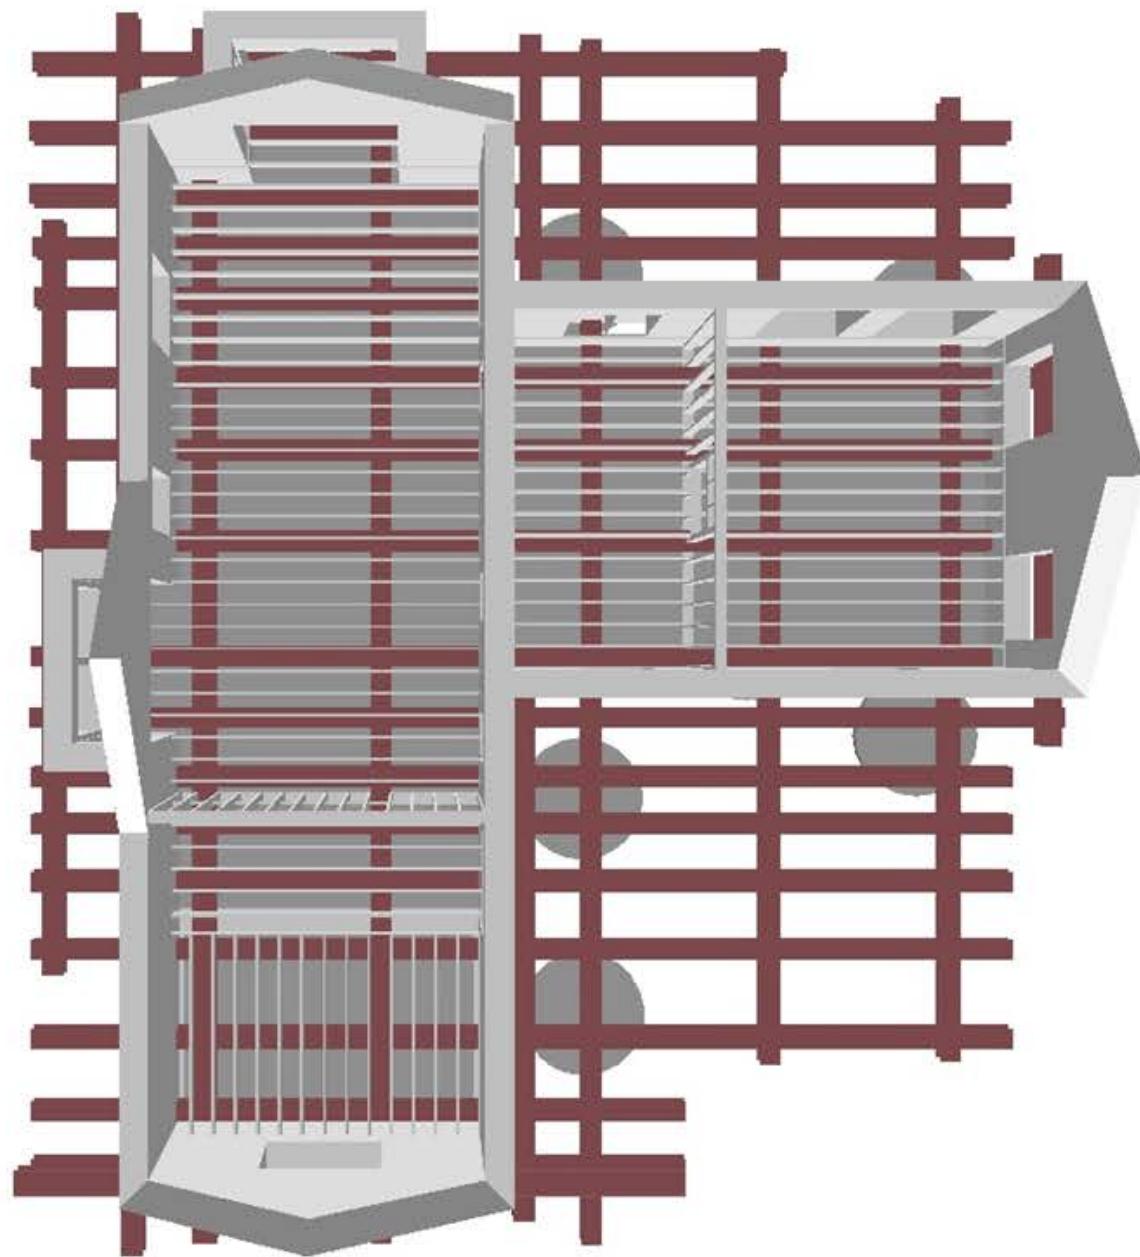





09/25/2006





00/28/2006





















**QUESTIONS?**