

BEFORE

REDUCE OVER ALL HEIGHT


REDUCE O.A.H.

KEEP PORTION OF 20" STEEL TO SLEEVE INTO 30" WITH NEW STOP PLATE AND 2 NEW RING PLATES.

REPAI

REPAIR 95 FT PYLON

- ADD CONCRETE PEDESTAL WITH RE-BARS AND EXTEND TO 12 INCH ABOVE GRADE. DOWEL RE-BARS INTO EXISTING FOOTING WITH EPOXY. COMPLETELY REMOVE RUST AND EXISTING PAINT FROM STEEL, PRIME AND PAINT PRIOR TO ADDING CONCRETE.

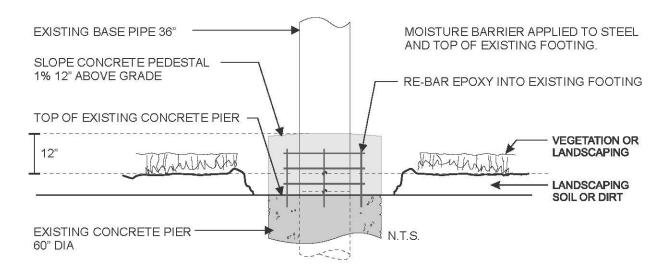

- 2ND AND 3RD TRANSITIONS FROM GRADE: ADD STEEL GUSSETS AS SHOWN ON DRAWING TO REINFORCE CAP PLATE (EXTENSION DEFICIENCY)
- ALL TRANSITIONS: CHECK ALL RING PLATES FOR PLUG WELDS AND ADD IF MISSING. ADD MINIMUM FOUR (4) ONE (1) INCH LONG WELDS @ EACH PLATE. ALSO COMPLETELY FILL EXISTING HOLES AT RING PLATES WITH WELD MATERIAL.
- 4 ALL TRANSITIONS: ADD ADDITIONAL WELD PASS BETWEEN CAP PLATE AND BOTTOM STEEL SUPPORT.
- SCRAPE / GRIND REMOVE OLD EXCESS PAINT AND RUST ON MAIN SUPPORT PIPE AT ALL TRANSITIONS FROM 1 FOOT ABOVE CAP PLATE TO 1 FOOT BELOW LOWEST RING PLATE. PRIME AND RE-PAINT.



Design #
0610405AR3

#363

4635 RITTIMAN RD SAN ANTONIO, TX

Acct. Rep. DEBBIE MOLTZ
Coordinator STEPHANIE MOORE

Designar

Date 6/11/15

Approval / Date
Client
Sales
Estimating
Art
Landord

Revision / Date

R3/2-26-161IH: REDUCE OAH

R1(06/12/15)JE-REMOVED SECONDARY CABINET AND AD DED A "AFTER" PHOTO.
R2(9/17/15)JH: ADD REPAIR SCOPE FROM ENGINEERING, ADD 35 TF PYLON WITH REPAIR SCOPE FROM ENGINEERING. SHOWING PEDESTAL. ADD SITE PLAN ON PAGE 1 WITH PYLON LOCATIONS,

Chandler Signs


3201 Manor Way	Dallas, TX 75235
214-902-2000	Fax 214-902-2044
17319 San Pedro, Ste 200	San Antonio, TX 78232
210-349-3804	Fax 210-349-8724
963 Baxter Avenue, Ste 200	Louisville, KY 40204
502-479-3075	Fax 502-412-0013
2584 Sand Hill Point Circle	Davenport, FL 33837
863-420-1100	Fax 863-424-1160
37 Waterfront Park Court	Dawsonville, GA 30534
800-851-7062	Fax 210-349-8724
P.O. Box 125 206 Doral Drive	Portland, TX 78374
361-563-5599	Fax 361-643-6533
1335 Park Center Drive, UNIT	Vista, CA 92081
760-967-7003	Fax 760-967-7033

This drawing is the property of Chandler Signs, L.P., L.L. and all rights to its use for the reproduction are reserved by Chandler Signs, L.P., L.L.P.





BOA-19-10300050 Subject Property – 4635 Rittiman Road

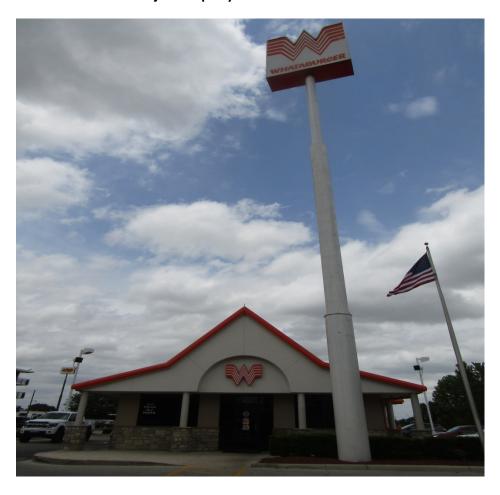

Neighboring Properties




Neighboring Properties



Neighboring Properties



Neighboring Properties

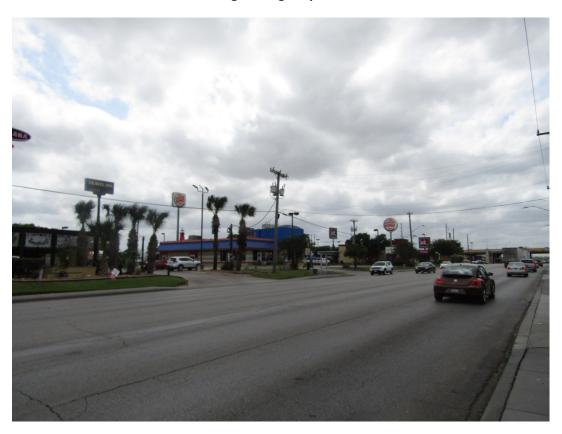

Neighboring Properties



Neighboring Properties

